



**Wipaire Worldwide
Anywhere, Anytime**

1700 Henry Avenue, South St. Paul, MN 55075

SERVICE LETTER NO: 29

SUBJECT: Tinnermans used to secure access covers to the top of the float.

MODEL:

SERIAL NO AFFECTED/EFFECTIVITY: 4000, 6000, 8000 Floats

COMPLIANCE REQUIRED: At time of next annual inspection, inspect and replace if necessary or at owner's discretion.

BACKGROUND INFORMATION: We have had some reports of tinnermans breaking. These parts secure the access covers to the top of the float. In some cases, corrosion was the cause, and because of corrosion, we changed the material from spring steel to stainless steel. We are also installing a strip teflon tape between the tinnermans and float. This should prevent the corrosion problem.

METHOD OF COMPLIANCE: At owner's discretion, install Kit No 14.

PARTS REQUIRED: Kit No 14.

MAN HOURS REQUIRED: Six manhours.

WARRANTY: Full coverage of all floats still under the initial 12 month float warranty period (parts and labor). 50% coverage for floats parts within the last 24 months. 25% coverage for float parts within the last 36 months.

DATE: 03-23-1993