SERVICE LETTER 125 PAGE 1 of 2 REV: A

SERVICE LETTER NUMBER 125			
TITLE: BOW BULKHEADS, LOWER FLANGE REINFORCEMENT			
BY: K. TAYLOR	AIRCRAFT MAKE/MODEL(S):	FLOAT MODEL(S):	NOTE(S):
APP: R. ADLER			OPTIONAL COMPLAINCE
DATE: 26-SEP-11	CESSNA 208, CARAVAN	8000S AND 8000A	S/L P/N 1005509
REV: A	VIKING DHC-3, OTTER		ECO 22250

FAA APPROVAL HAS BEEN OBTAINED FOR TECHNICAL DATA IN THIS PUBLICATION THAT AFFECTS STC OR TSO DESIGN COMPLIANCE

## **EFFECTIVITY:**

This service letter applies to all S/N Wipline model 8000A/S, amphibian and seaplane floats, as installed on Cessna 208 Caravan and Viking DHC-3 Otter aircraft. This service letter applies to aircraft equipped with the following STCs:

STC SA270CH, SA149CH, or SA1311GL – Model 208 with 8000 seaplane or amphibian floats at 600 or 675 HP

STC SA331CH - Viking DHC-3 with model 8000 seaplane or amphibian floats

## **COMPLIANCE:**

Service letter compliance is optional, and is recommended for aircraft operating regularly in rough water conditions.

## **BACKGROUND:**

Certain aircraft operated in rough water regularly may experience cracking of the lower bulkhead flanges on the bow area of the float. This service letter and associated kit reinforce the lower bulkhead flanges of the bow bulkheads to assist in load transfer and reduce probability of cracking as a result of operations on rough water.

## **COMPLIANCE METHOD:**

Install the parts included in service kit 81 in accordance with the instructions in the Technical Data section of this service letter.

# APPROX. SHOP HOURS:

This service letter will take approximately 20 labor hours to complete.

## WARRANTY INFORMATION:

Parts and labor warranty is not included for this modification.

## TECHNICAL DATA:

Copies of this service letter, associated service kit, float service manual, and float parts manual are available on the website <a href="https://www.wipaire.com">www.wipaire.com</a>.

See service kit number 81 for a list of parts applicable to this modification.

For basic model 8000 maintenance information, see Wipaire Service Manual P/N 1002554.

For basic model 8000 parts information, see Wipaire Parts Manual P/N 1002178

To accomplish this modification: Install doublers P/N 1005147 and 1005146 on the lower bow bulkhead flanges at stations 11 thru 16 in accordance with drawing 1005526 latest revision. Drawing 1005526 is attached to this service letter.

## **NOTES:**

After completion of the instructions in this service letter, make an entry as such in the aircraft logbook in accordance with your local Civil Aviation regulations.

Wipaire considers the weight and balance effect of this modification to be negligible; however, consult your local Civil Aviation Regulations with respect to logbook weight and balance entry requirements.

### END ###

