

SERVICE LETTER: 37

DATE: January 20, 1997

<u>TITLE</u>: Installation-oil filter, float hydraulic system

EFFECTIVITY: Applicable to all Model DeHavilland Twin Otter, Model 300 with Wipline Model

13000 Floats Installed. S/N 1 thru 22

REASON: Hydraulic oil contamination in the landing gear hydraulics.

COMPLIANCE: At owners discretion.

BACKGROUND INFORMATION:

Hydraulic oil contamination will develop over time in your hydraulic system. This is a variety of dirt, water, and fungi (black Mass), and this will plug the filter screen in your hydraulic oil tank.

The installation of this oil filter system will filter out this contamination and prevent hydraulic pump damage.

NOTE: THE FOLLOWING SHOULD BE DONE ON A REGULAR BASIS.

It is recommended that the hydraulic oil tank be removed and the oil and filter screen be inspected for contamination. Remove contaminated oil and clean the filter screen.

METHOD OF COMPLIANCE: Installation per Installation drawing 6D1-2287

PARTS REQUIRED: Installation drawing 6D1-2287

SHOP HOURS REQUIRED: 3 Hours

WARRANTY: Parts and Labor for 18 months past the issuance of this service letter.

Rev A 1002415

2. IKILL LIJI INIJ KLVETS UN DL-\$-2151 BKALKEI (NUJEL)
3. DISZSBABLE FILTER ADAPTER PERN 683-25280 MOINT TE NECESSARY
4. LICKTE & CLEEG BS3-25280 MOINT BETWERN MANIFOLD. AND GC3-2151 BRACKET
5. INSE MOINT TO MATCH DRILL 8 (#30 (*128) DIA) HOLES INTO GC3-2151 BRACKET
6. RIVET GC3-2151 BRACKET
7. REMOINT MANIFOLD LISTING RARDIMARE NOTED IN GD2-2286 ASSEMBLY - FILTER - HYDRALLIC PLIMP
8. REASSEMBLE FILTER ADAPTER TO MOINT IF REMOIND AND SAFETY WIRE

MAT'L				Chr dar dra	
FINISH	_			8520 RIVER RDAD, INVER GRIDVE HEIGHTS, MN. 55076	
	¥	DATE	TOLERANCES	TITLE TNCTI - FTI TEP HYDRAIII TO PIIMP	
25	Ð	1/20/97	.00 ±.015	STATE M	ě
PP0	-J GddY	4/15/g/	1000 ± 000	HEDITAL 150 11 501 2287 12	į

Rev A 1002415