



WIPLINE FLOATS • SKIS • MODIFICATIONS • AIRCRAFT SALES  
AVIONICS • INTERIOR • MAINTENANCE • PAINT REFINISHING

## SERVICE LETTER 216

### Cessna 208 Caravan 8000A & 8750A Hydraulic Pump Replacement

<b>Aircraft Makes/Model(s):</b>	<b>Float Model(s):</b>	<b>Compliance:</b> Optional	<b>By:</b> MAS
Textron Aviation 208	8000A & 8750A	<b>Part Number:</b> 1011602	<b>Approved:</b> DRH
		<b>Date:</b> 4/29/2024	<b>Revision:</b> C

### LOG OF REVISIONS

Revision	Description	Date
A	Initial release	5/7/2021
B	Added note in Background section for Service Letter 252.	4/11/2023
C	Updated note in Background section about Aero Twin extended baggage.	4/29/2024

FAA approval has been obtained for technical data in this publication that affects STC or TSO design compliance.

#### EFFECTIVITY:

This service letter applies to Textron Aviation model 208 with Wipline 8000 Amphibian Floats and Wipline 8750 Amphibian Floats installed per STC SA1311GL.

#### COMPLIANCE:

Optional compliance

#### BACKGROUND:

Hydraulic Pump Assembly p/n 8A09000-031 has been discontinued. This service letter provides the option to replace it with a new pump p/n 1011404.

**Note:** To accommodate the new hydraulic pump assembly, reference Service Letter 252 to add additional sight-glass port and larger fill-port access to existing Extended Baggage Cargo assemblies installed per STC SA04388CH. For aircraft equipped with the Aero Twin extended baggage, replace the hydraulic pump cover with Wipaire cover 1011919. Reference Wipaire drawing 1006588.

#### COMPLIANCE METHOD:

Install provided parts as shown in the Work Instruction section of this service letter.

#### APPROXIMATE SHOP HOURS:

The work instruction for this service letter will take approximately 8 labor hours.

#### WEIGHT AND BALANCE CHANGE:

+3.03 lbs, F.S. 286.23

#### WARRANTY INFORMATION:

This service letter does not include warranty for labor and parts.

1700 Henry Ave - Fleming Field (KSGS), South St. Paul, MN 55075

Phone: 651.451.1205 | Fax: 651.457.7858


www.wipaire.com

**TECHNICAL DATA:**


Copies of this service letter, associated service kit (if applicable), float service manual, and float parts manual are available at [www.wipaire.com](http://www.wipaire.com).

**ITEMS PROVIDED IN SERVICE KIT 1011602-01**

ITEM	QTY	PART NUMBER	DESCRIPTION
1	1	1011404	Assembly, Hydraulic Power Pack
2	2	320559	Crimp Terminal, Butt, 22-16 AWG

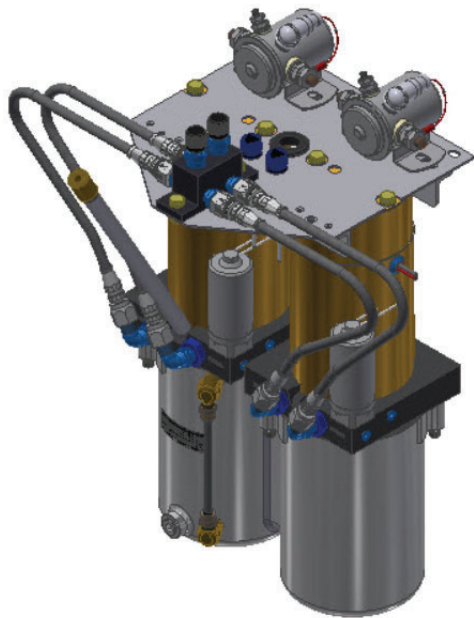


**DISCONTINUED**  
**HYDRAULIC PUMP 8A09000-031**

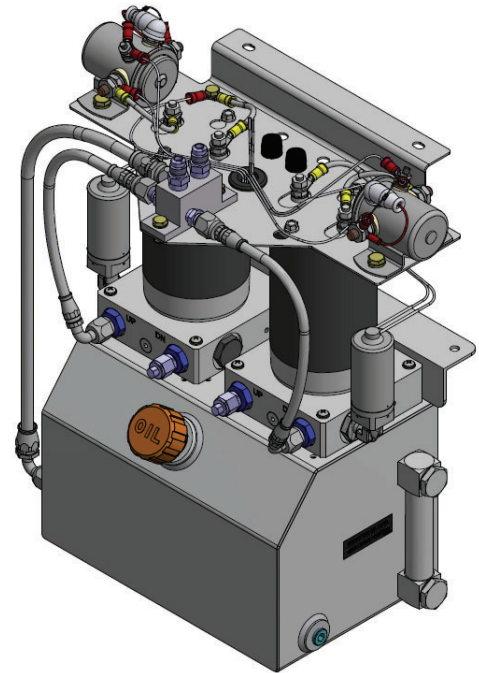

**NEW**  
**HYDRAULIC PUMP 1011404**


## Work Instruction

1. Pull Pump 1 and Pump 2 circuit breakers.
2. Remove and cap both pressure and return hydraulic lines on hydraulic pump manifold 6A09000-027.
3. Remove GA1 and GA4 wires (12 ga) from electrical solenoids on hydraulic power pack 8A09000-031.

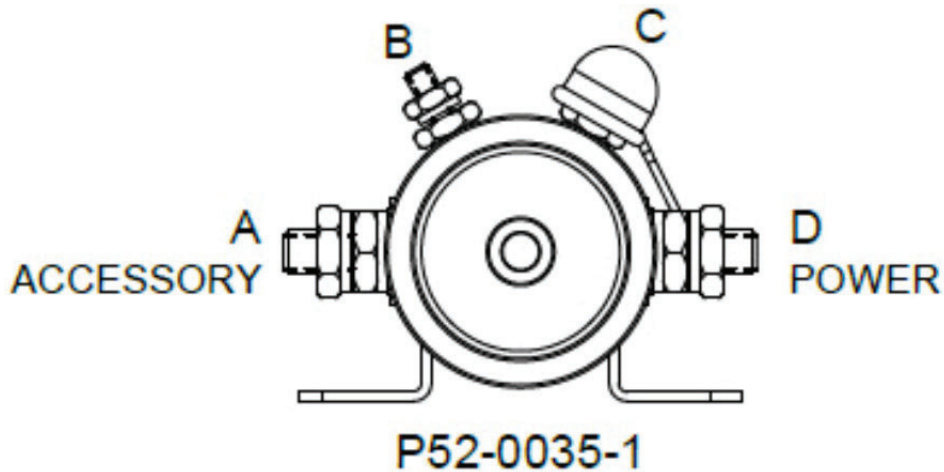


**SOLENOID SCHEMATIC**

4. Cut GE10 and GE11 wires (20 ga) at butt splice connection. If aircraft has G1000 avionics, cut GE21 and GE22 (20 ga) wires.
5. Unbolt and remove hydraulic power pack 8A09000-031 from pump mount assembly.
6. Install new hydraulic power pack 1011404 onto pump mount assembly using existing hardware.
7. Install pressure and return line to hydraulic pump manifold. Refer to hydraulic schematic.

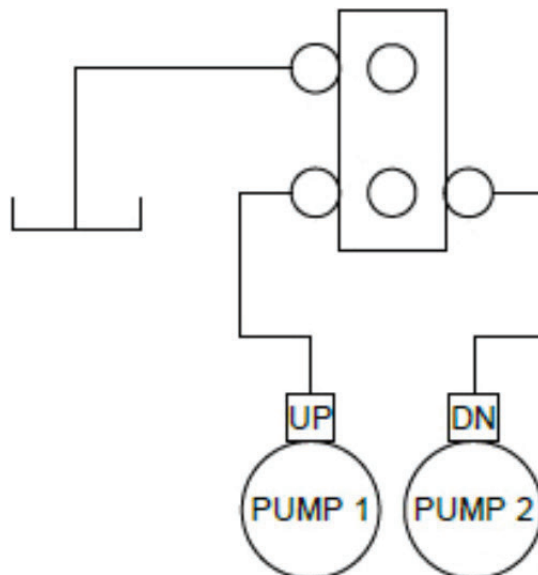


**HYDRAULIC SCHEMATIC**

8. Re-install GE10 and GE11 wires (20 ga), or GE21 and GE22 for G1000 equip aircraft, onto wires coming from fuse holder with supplied butt splice connectors. See electrical schematic.

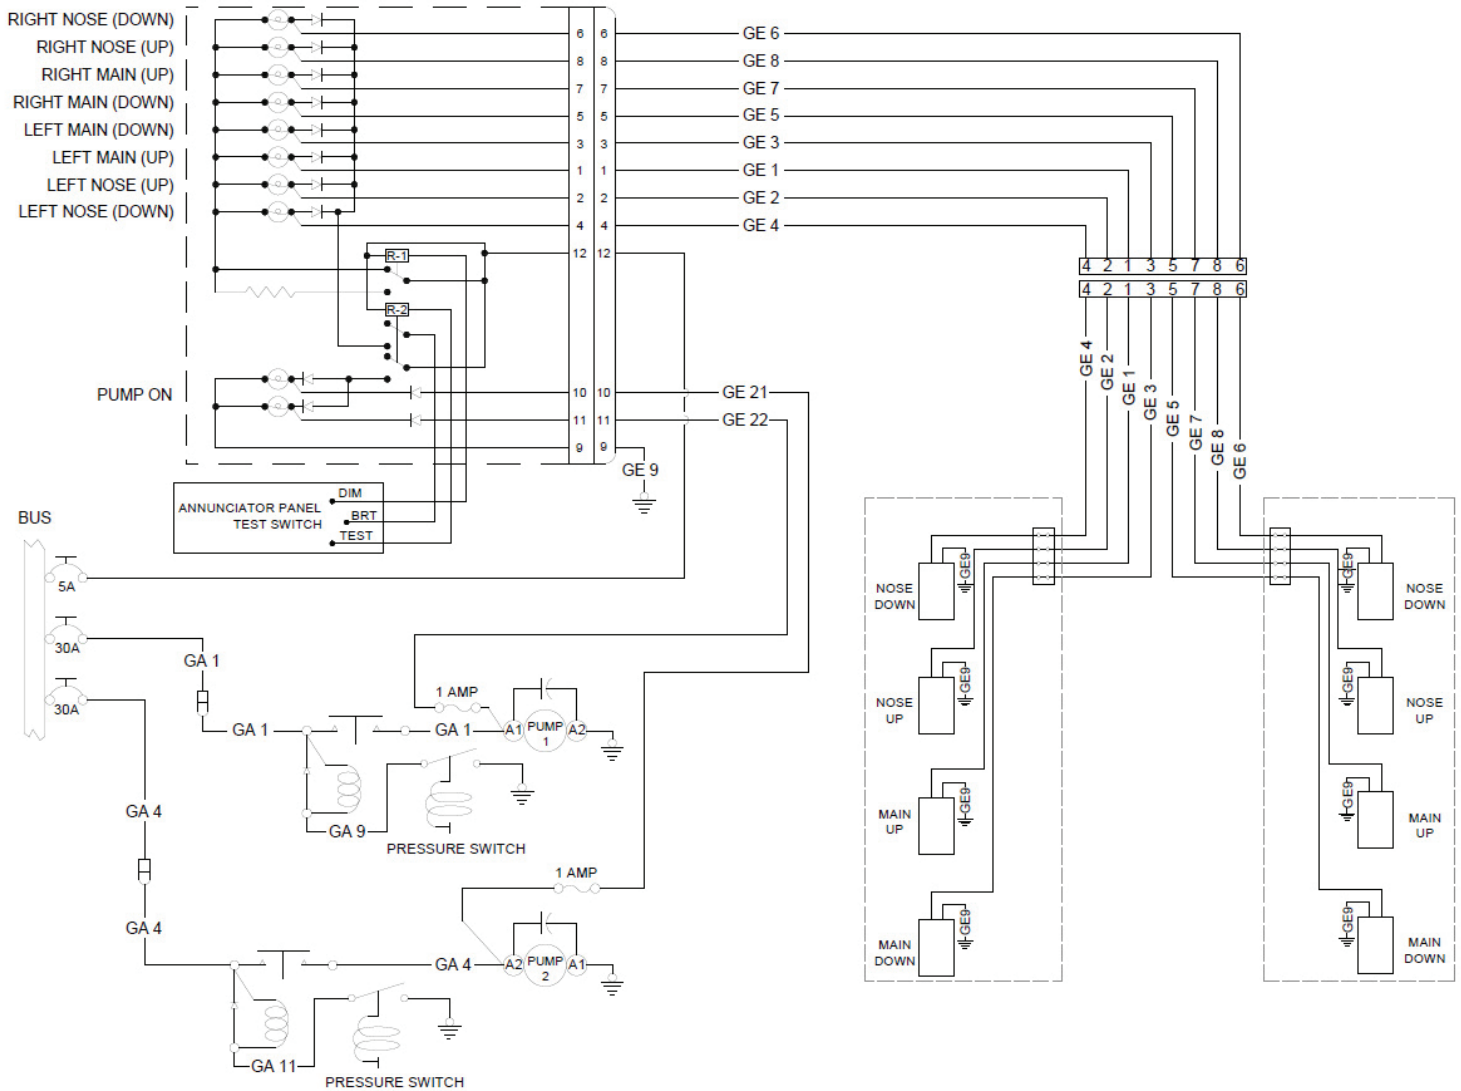

**ELECTRICAL SCHEMATIC (G1000 EQUIPPED AIRCRAFT)**

9. Re-install GA1 and GA4 wires (12 ga) onto electrical solenoids on hydraulic power pack 1011404. See electrical schematic.

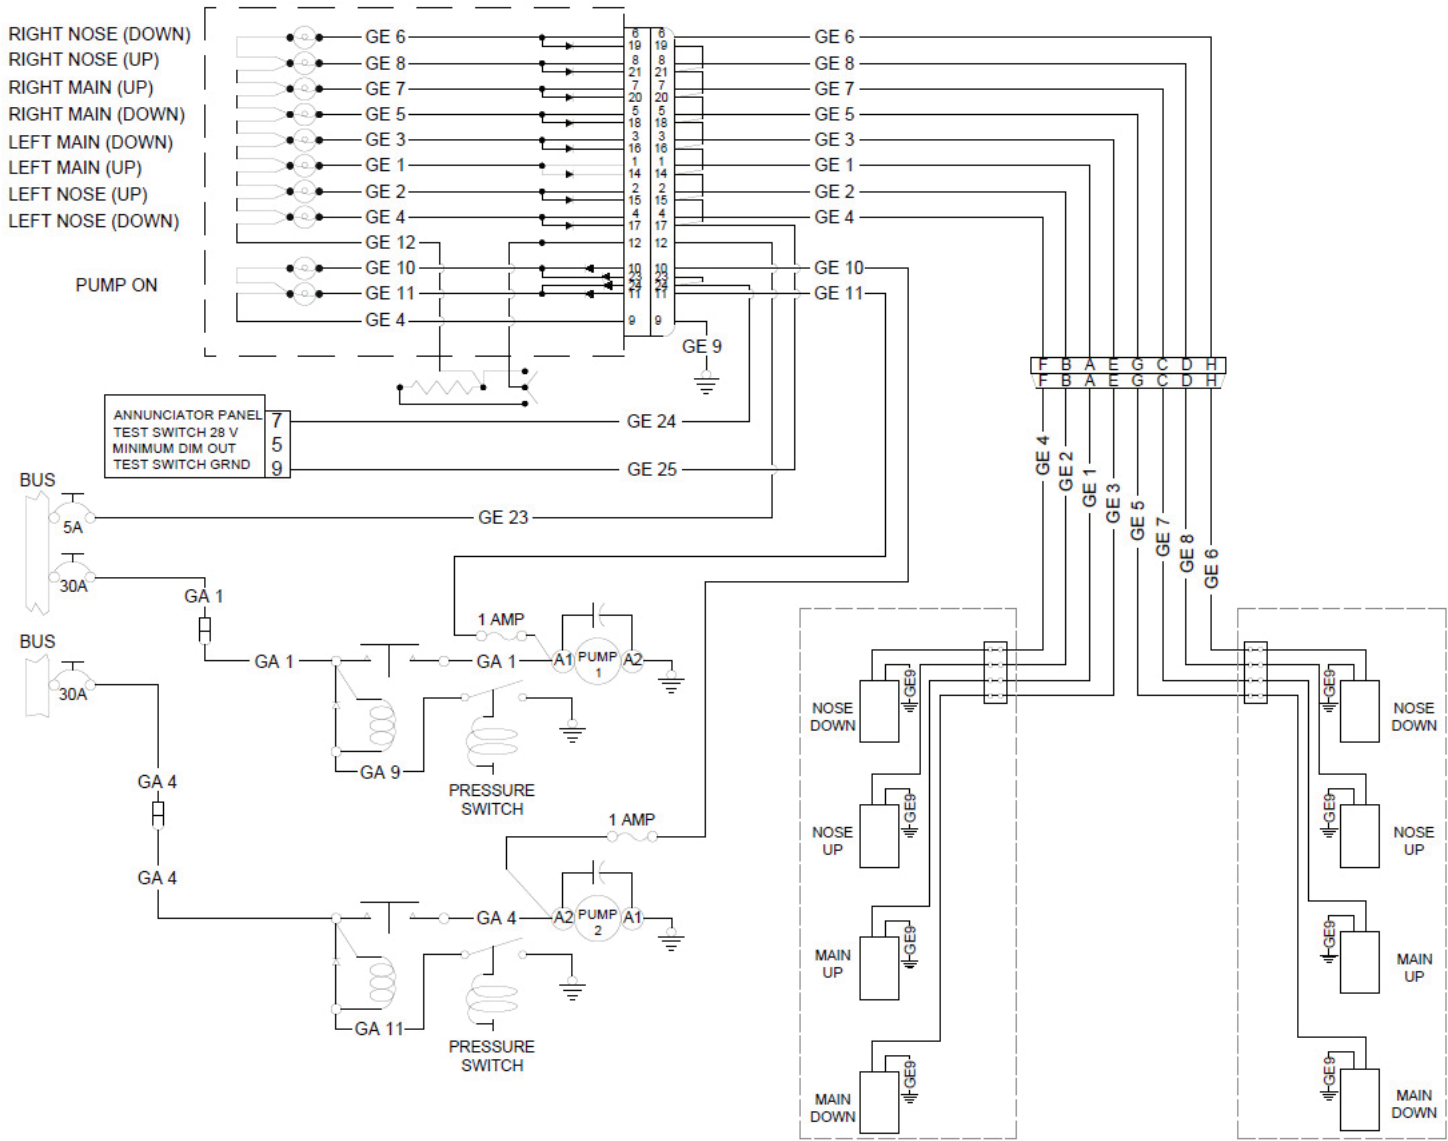

**ELECTRICAL SCHEMATIC**

- Reset Pump 1 and Pump 2 circuit breakers, service pump reservoir with MIL-H-5606 hydraulic fluid, and perform a retraction/extension test to make sure system is functioning correctly. Watch the system for leaks and add MIL-H-5606 hydraulic fluid as needed.

### Aircraft Closing & Return to Service

- Upon completion of inspection, enter information in Aircraft Logbook for completion of Wipaire Service Letter 216.